


Basic information



Mode switching

Switch: Long press for 3s to switch on or off.
The lamp enters the sensor mode by default after turn on.
Mode switching: Press lightly to switch the mode after turn on.
Normal mode (blue indicator light) ,
Sensor mode (orange indicator light)

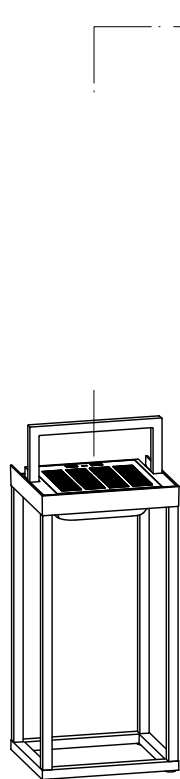

Indicator

- 1.Low battery: flashing orange light
- 2.On charge: flashing green light
- 3.Fully charged: steady green light
- 4.Normal mode: blue light will be on for 10s
- 5.Sensor mode: orange light will be on for 3s.



Function Key

Sensor mode: Long press to adjust brightness.
Normal mode: Long press to adjust brightness.
Quick tap to standby.

Power: 2W

color rendering index: CRI 80

Dimming: 5%-100%

Input : 5V = 1A

Adapter : 220-240V~50/60Hz

Battery: 2x2200mAh 3.7V

Charging time: 5hrs

Working time: 10-120hrs


IP rating: IP54

Protection class : Class III

Accessory list :




Switch (sensor mode)

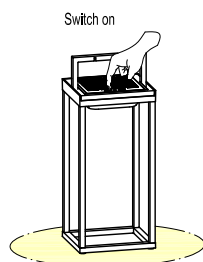


Long press for 3s to turn on the lamp.
Then quick tap and the orange indicator will light up for 3s.


Stepless Dimming

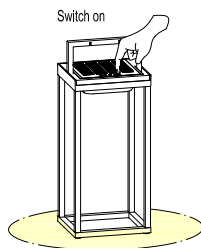

When the day light is less than 50lux, the lamp will turn on automatically. Long press the switch until obtain the desired brightness and then release the switch.
Memory function: The light intensity will correspond to the previously set intensity after restart except the lamp runs out of battery.

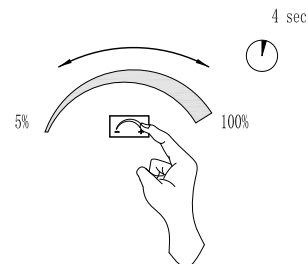


Switch (Normal mode)

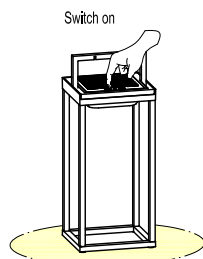


Long press for 3s to turn on the lamp.
Then quick tap and the blue indicator will light up for 10s.


Stepless Dimming

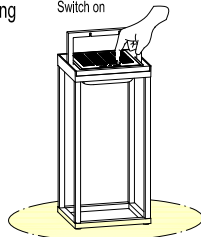



When the lamp is on, long press the switch until obtain the desired brightness and then release the switch. Quick tap to turn off.
Memory function: The light intensity will correspond to the previously set intensity after restart except the lamp runs out of battery.

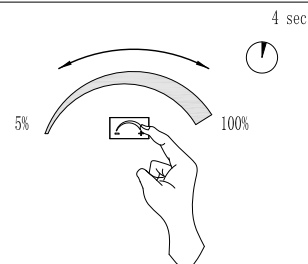

Low Battery Alert

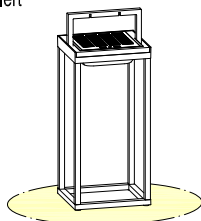

Battery charging

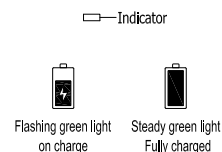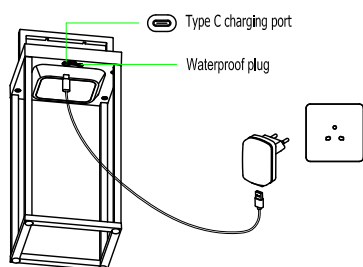

1. Fully charge the battery before initial use.
2. Please charge the battery in the following cases.
Battery charges $\leq 20\%$: Orange indicator will flash 5 times.
Battery charges $\leq 10\%$: Orange indicator will flash 5 times.
Battery charges $\leq 5\%$: Orange indicator will flash 5 times in every ten minutes.

Open the waterproof plug. Insert the Type C charging cable and charge about 5hrs. Unplug the cable until the green light is steady.
Then restore the waterproof plug.

The green indicator will flash if the lamp is on charge.
The green indicator will be steady if the lamp is fully charged.
The average charging time is 5 hours.

Installation Diagram	1	2	3	4	5

Important:

1. The lamp works normally even when it is on charge.
2. The battery has an overload protection function.
3. The support surface for the lamp must not exceed a 15° tilt or it will fall.
4. It is advisable to use the original charger. Alternatively, you can use a certified charger.
5. The best ambient temperature range is $10\sim 45^\circ\text{C}$. Lower or higher temperature will shorten the battery lifetime. Please do not use this lamp under direct sunshine.
6. Fully charge the battery before initial use. The lamp should be charged in regular intervals to prolong the battery lifetime. If the lamp is not used for a long time, please charge every three months to avoid the battery damage. In order to guarantee the battery quality, if the lamp has run out of the battery, please charge for 10 minutes before turn on.
7. We recommend a soft cloth to clean the lamp. The cloth can be humid with a little water if needed. Please do not use alcohol or other aggressive cleaning agents.

